

Work Order ID 144438

April 18, 2016 10:32:04 AM

144438

Needed to ship May 6.

Page 1

Item ID: D4682-045

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Wearplate Assembly

Start Date: 4/20/2016 Start Qty: 2.00

~~***~~ 6 ~~8~~ ~~6~~

Cust Item ID:

Required Date: 4/28/2016 Req'd Qty: 2.00

Customer:

Reference:

Approvals: Process Plan: SLT 20160418

Run Start *NR1*

QC: _____ Date: _____ Tooling: _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D4682	D

110 0.00

110

Waterjet

Memo

0.00

FLOW CNC Waterjet

1-Cut as per dwg D4682-5

prog rev: D

dwg rev: D

2-Deburr if required

(6)

22 16/04/19

120

QC2- Inspect parts off machine FAI/FAIB

0.00

120

QC

Memo

0.00

Quality Control

(6)

22 16/04/19

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 144438

April 18, 2016 10:32:04 AM

144438

Page 3

Item ID: D4682-045 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Wearplate Assembly
Start Date: 4/20/2016 Start Qty: 2.00 ***2*** Cust Item ID:
Required Date: 4/28/2016 Req'd Qty: 2.00 ***2*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* Large Fab Large Fab	Weld per dwg A/R Hardcoat S.S. Batch: <u>127737</u> Memo 1- Weld hardcoat as per dwg and QSI004 2- Weld shim to wearplate as per dwg and QSI004 A/R s.s. rod Batch #: <u>126014</u>	0.00 0.00				<u>6</u>		<u>16-05-12</u> <u>ML</u>	
170 *170* QC Quality Control	QC9- Inspect visual per QSI004- Fusion Welds Memo	0.00 0.00				<u>6</u>	<u>16-05-13</u>	<u>PD</u>	
180 *180* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00				<u>6</u>	<u>16-05-13</u>	<u>PD</u>	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

April 18, 2016 10:32:04 AM

Page 4

Accept

Setup Start *NS1*

Stop *NS2*

Stop *NS2*

Cust Item ID:

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run	Start	*NR1*
	Stop	*NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190		0.00							
190									DAS 41 9-89
HandFinish	Memo	0.00				6			16-5-16
Hand Finishing	1- Apply Rockguard on entire concave surface as per dwg A/R Rockguard Batch: <u>134681</u>								
	2- Indicate FWD direction as shown using white paint marker(SEE NOTE 11)								
200									
200									DAS 38 9-89
QC	Memo	0.00				6			MAY 16 2016
Quality Control									
210									
210									
Packaging	Identify as per dwg & Stock Location: <u>Stock</u>	0.00							
Packaging	Memo	0.00				6			DAS 6 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

Work Order ID 144438

April 18, 2016 10:32:04 AM

144438

Page 5

Item ID: D4682-045 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Wearplate Assembly
Start Date: 4/20/2016 Start Qty: 2.00 ***2*** Cust Item ID:
Required Date: 4/28/2016 Req'd Qty: 2.00 ***2*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220	QC21- Final Inspection - Work Order Release	0.00							
220									
QC	Memo	0.00							
Quality Control									

MAY 17 2016

MAY 17 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :									
Misidentified ☐	Past Due ☐										

Picklist Print

April 18, 2016 10:32:07 AM

Page 1

Work Order ID: 144438

144438

Parent Item: D4682-045

D4682-045

Parent Item Name: Wearplate Assembly

Start Date: 4/20/2016

Required Date: 4/28/2016

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP REV:A 13.03.27 NEW ISSUE DD VERF:JLM IPP REV:B
13.11.14 AS PER DWG REV.B DD VERF:JLM IPP REV:C 14.11.24
AS PER DWG REV.C DD VERF:JLM IPP REV:D 15.06.10 AS PER
DWG REV.D DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4682-9

Manufactured No

Each 18.0000

4

D4682-9

**

Wearplate Shim

Location

Loc Qty

Loc Code

WA002

18

[141356]

18

M304S18GA

Purchased No

110 sf

399.4482 2.066

4.349474

M304S18GA

**

304/316 .050 Sheet

Location

Loc Qty

Loc Code

MAT020

178.096

M133328

124.496

M133587

53.6

MAT20

128

M134580

128

TPI

93.3522

M134604

93.3522


16-05-12

JSC

22/04/19

12

ITEM	QTY	P/N	DESCRIPTION
	X	D4682-041	WEARPLATE ASSY
1	1	D4682-1	WEARPLATE
2	1	D4682-9	WEARPLATE SHIM

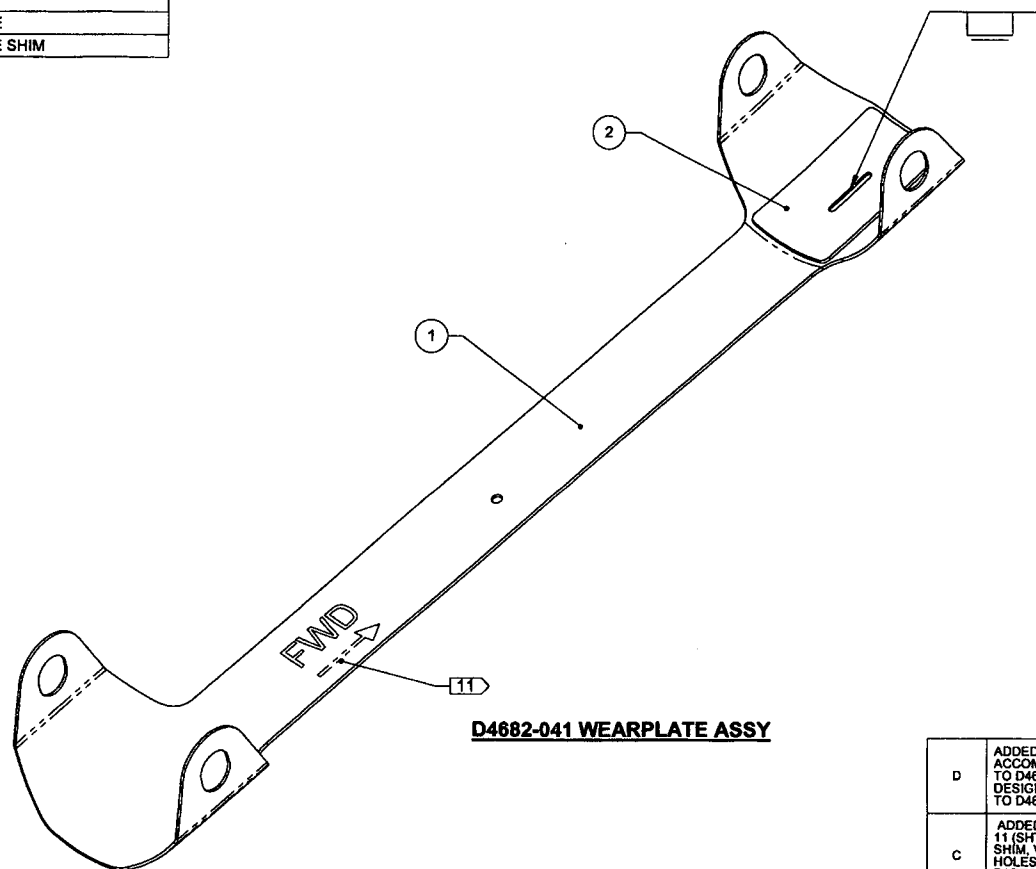

D4682-041 WEARPLATE ASSY

20160418
SH 144438

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY PER QSI 044 METHOD 6.1
- 7) WEIGHT: 1.06 lbs
- 8) WELDING: PER QSI 004
- 9) COAT ENTIRE TOP (CONCAVE) SURFACE WITH TEXTURED COATING, 0.020-0.040 THICK PER QSI 005 SECTION 4.9
- 10) OPEN UP DRAIN HOLE IF NECESSARY TO $\varnothing 0.188$ AFTER APPLYING TEXTURED COATING
- 11) INDICATE FWD DIRECTION IN LOCATION SHOWN USING WHITE PAINT MARKER

RELEASED
2015-06-08
ECW 15-551

D	ADDED SHT 2, WEARPLATE FORMING MODIFIED TO ACCOMMODATE MATERIAL SPRING BACK, ADD FWD BEND TO D4682-041, MINOR DIM CHANGES, D4682-9 RE-DESIGNED, D4682-11 REMOVED, ADD FWD INDICATION TO D4682-045/-7	AP	15.03.24
C	ADDED FWD INDICATION ON D4682-041/-043 PER NOTE 11 (SHT 1), D4682-11 SHIM (SHT 8) REPLACED D4769-3 SHIM, VARIOUS DIMENSIONAL CHANGES TO THRU HOLES AND OVERALL DIMENSIONS OF D4682-1/-3/-5/-9 PARTS, REFERENCE TO PLUS ONE ROCKGUARD REMOVED.	AP	14.07.29
B	THRU HOLES NOW SLOTS, VARIOUS DIMENSIONAL CHANGES, $\varnothing 0.188$ HOLE MOVED (B5-3), UPDATED PART WEIGHTS, REMOVED GRAIN DIR ON ALL PARTS D4769-3 WAS D4682-9 ON D4682-041 WEARPLATE ASSY.	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 1 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

APPROVED

ITEM	QTY -043	P/N	DESCRIPTION
	X	D4682-043	WEARPLATE ASSY
1	1	D4682-3	WEARPLATE
2	1	D4682-9	WEARPLATE SHIM

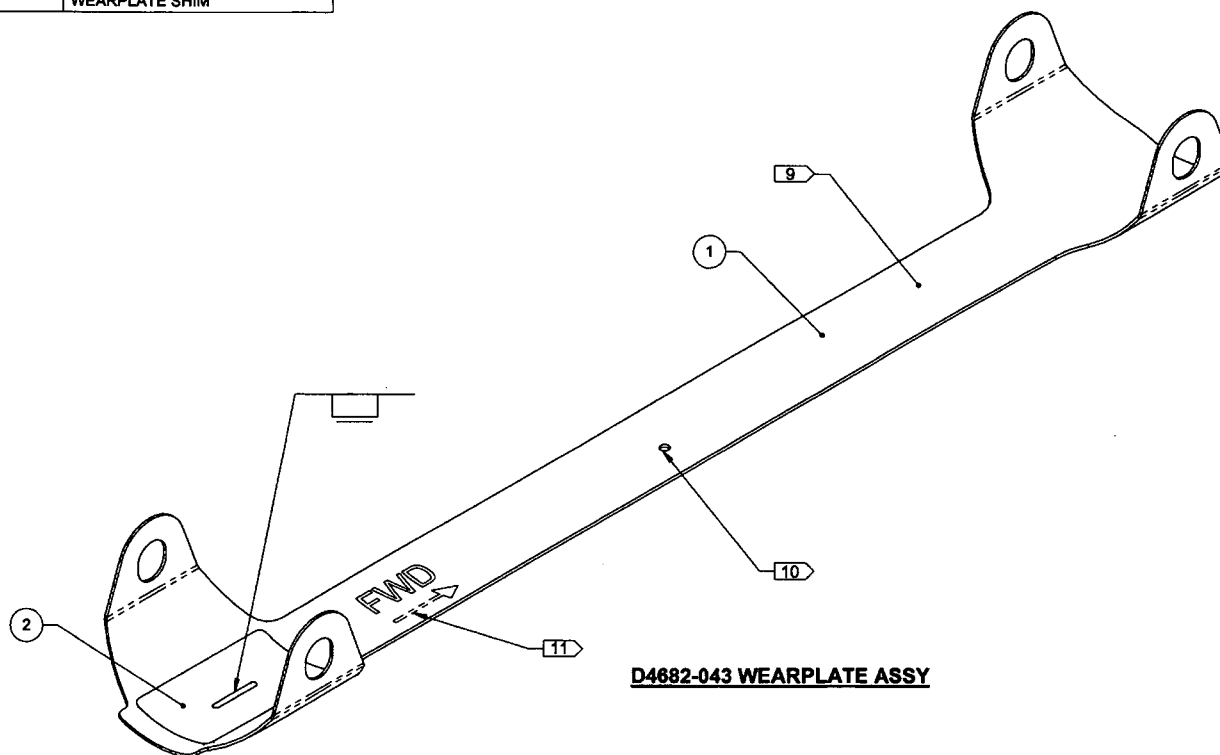

D4682-043 WEARPLATE ASSY

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY PER QSI 044 METHOD 6.1
- 7) WEIGHT: 1.20 lbs
- 8) WELDING: PER QSI 004
- 9) COAT ENTIRE TOP (CONCAVE) SURFACE WITH TEXTURED COATING, 0.020-0.040 THICK PER QSI 005 SECTION 4.9
- 10) OPEN UP DRAIN HOLE IF NECESSARY TO $\phi 0.188$ AFTER APPLYING TEXTURED COATING
- 11) INDICATE FWD DIRECTION IN LOCATION SHOWN USING WHITE PAINT MARKER

RELEASED
2015-06-08

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 2 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

ITEM	QTY	P/N	DESCRIPTION
	X	D4682-045	WEARPLATE ASSY
1	1	D4682-5	WEARPLATE
2	1	D4682-9	WEARPLATE SHIM

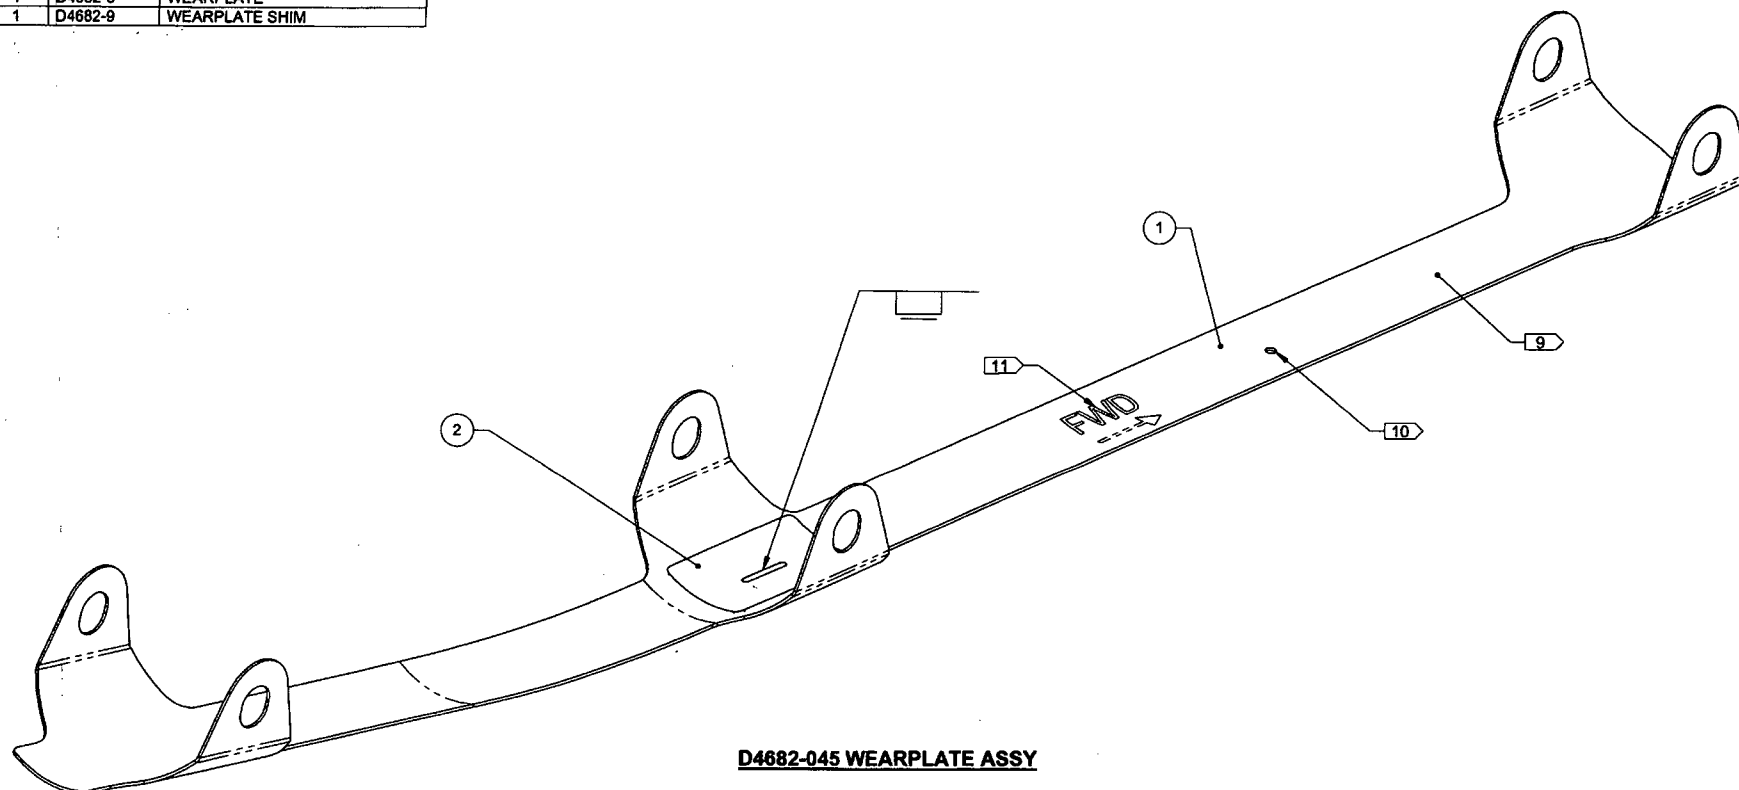

D4682-045 WEARPLATE ASSY


RELEASED
2015-06-08

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY PER QSI 044 METHOD 6.1
- 7) WEIGHT: 1.85 lbs
- 8) WELDING: PER QSI 004
- 9) COAT ENTIRE TOP (CONCAVE) SURFACE WITH TEXTURED COATING, 0.020-0.040 THICK PER QSI 005 SECTION 4.9
- 10) OPEN UP DRAIN HOLE IF NECESSARY TO $\phi 0.188$ AFTER APPLYING TEXTURED COATING
- 11) INDICATE FWD DIRECTION IN LOCATION SHOWN USING WHITE PAINT MARKER

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 3 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

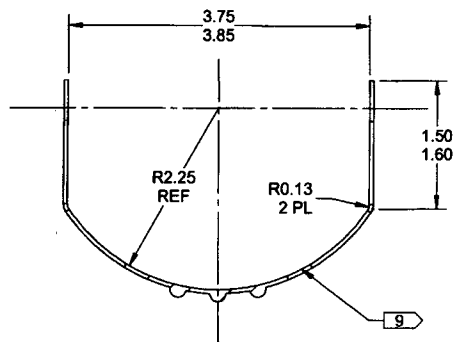


SECTION A-A
SCALE 2X

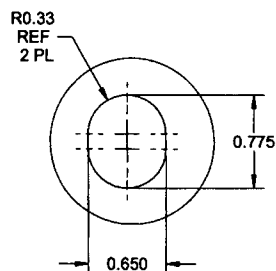



DETAIL B
SCALE 3X
4 PL

NOTES:

- 1) MATERIAL: AISI 304/316 STAINLESS STEEL PER MIL-S-5059 OR AMS 5513 OR AMS 5524 OR ASTM A240 OR ASME SA240 18 GAUGE 0.050 THICK, REF DART SPEC. M304S18GA
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 0.99 lbs
- 8) WELDING: PER QSI 004. APPLY LAYER OF 2059B HARDCOAT WELD TO 0.063 - 0.125 HIGH AFTER BENDING
- 9) FORM USING R1.9 DIE

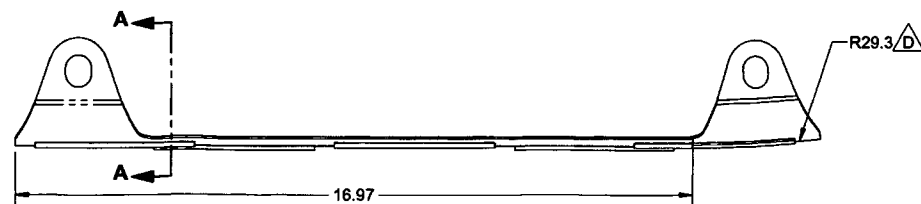

D4682-1 WEARPLATE
(MAKE FROM D4682-1F)

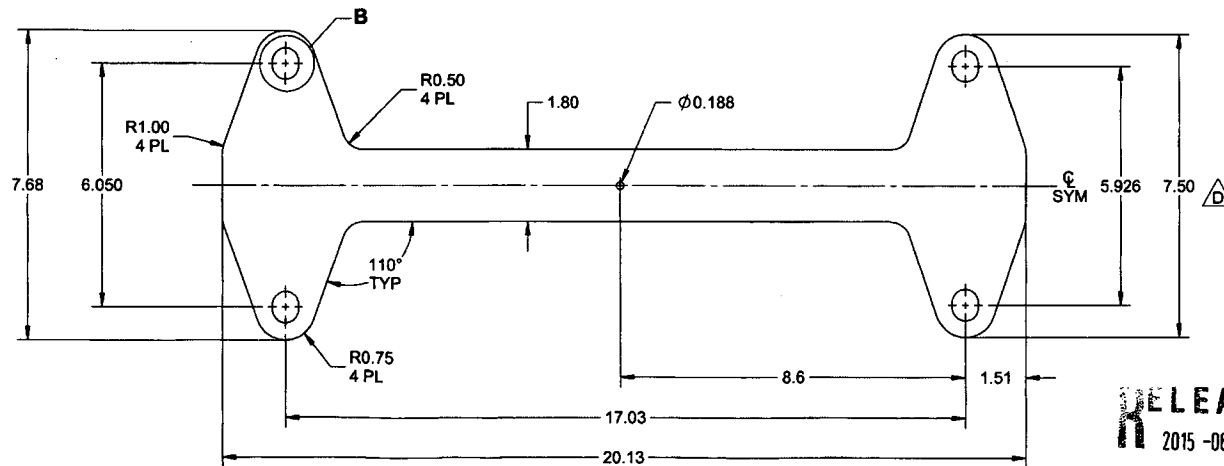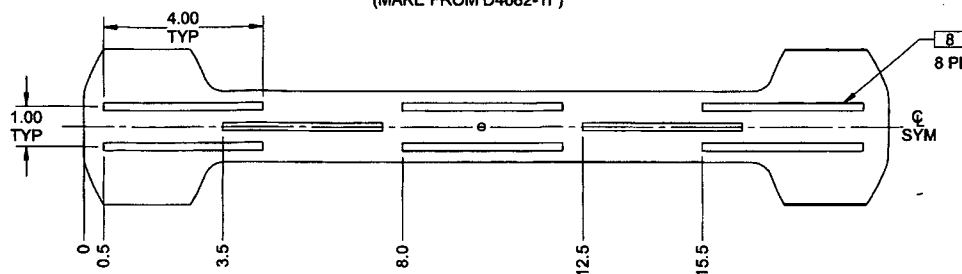


D4682-1F WEARPLATE
(FLAT PATTERN)


RELEASED
2015-06-08

APPROVED


DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	KENT, WA	
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 4 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

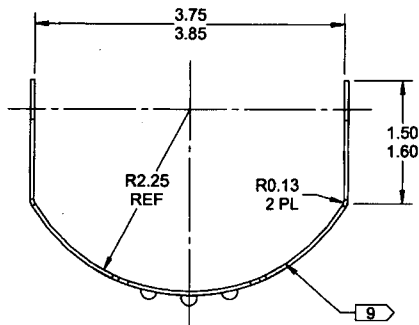


D4682-3 WEARPLATE
(AUXILIARY VIEW) D

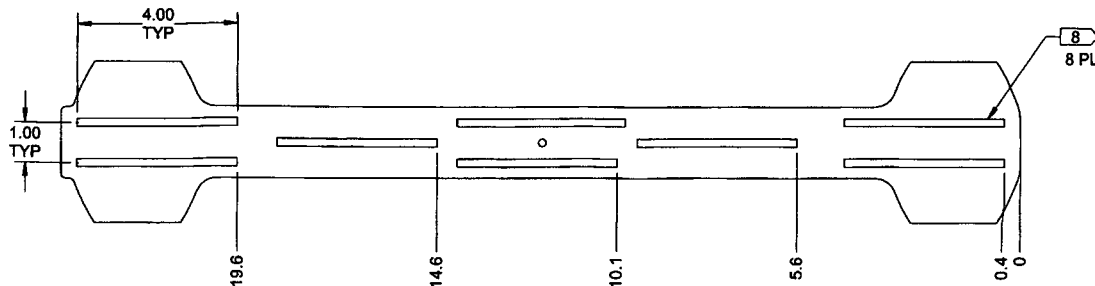

D4682-3 WEARPLATE
(MAKE FROM D4682-3F)

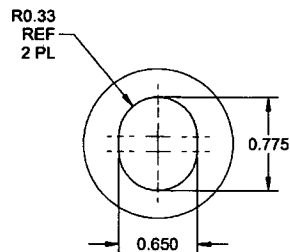

DETAIL C
SCALE 3X
4 PL

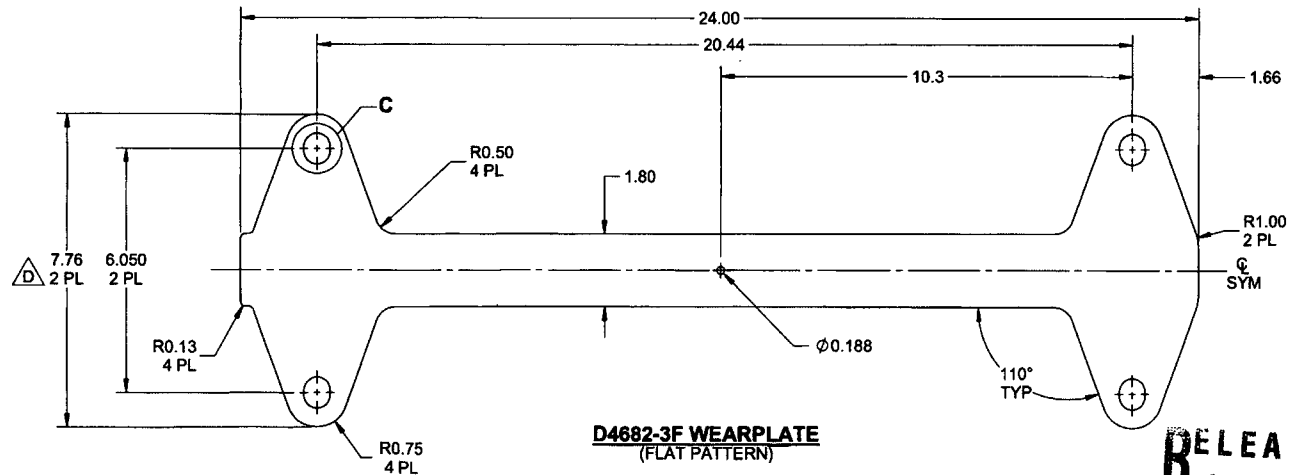


D4682-3F WEARPLATE
(FLAT PATTERN)

NOTES:


- 1) MATERIAL: AISI 304/316 STAINLESS STEEL PER MIL-S-5059 OR AMS 5513 OR AMS 5524 OR ASTM A240 OR ASME SA240 18 GAUGE 0.050 THICK, REF DART SPEC. M304S18GA
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 1.12 lbs
- 8) WELDING: PER QSI 004. APPLY LAYER OF 2059B HARDCOAT WELD TO 0.063 - 0.125 HIGH AFTER BENDING
- 9) FORM USING R1.9 DIE

RELEASED
2015-06-08


APPROVED	DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
	DRAWN	AP		
	CHECKED	AJS	DRAWING NO.	REV. D
	MFG. APPR.	DD	D4682	SHEET 5 OF 8
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	WEARPLATE ASSY	NTS
DATE		15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

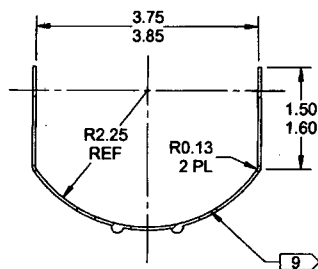



SECTION D-D
SCALE 2X

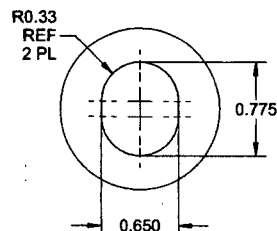

DETAIL E
SCALE 4X
6 PL

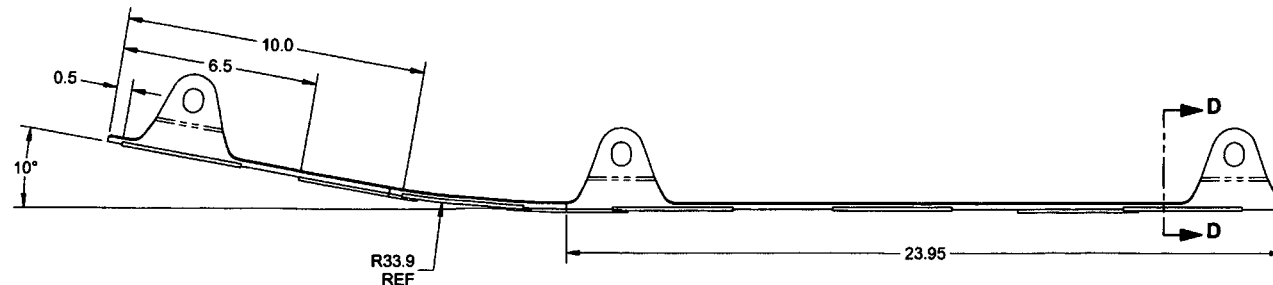

D4682-5 WEARPLATE
(MAKE FROM D4682-5F)

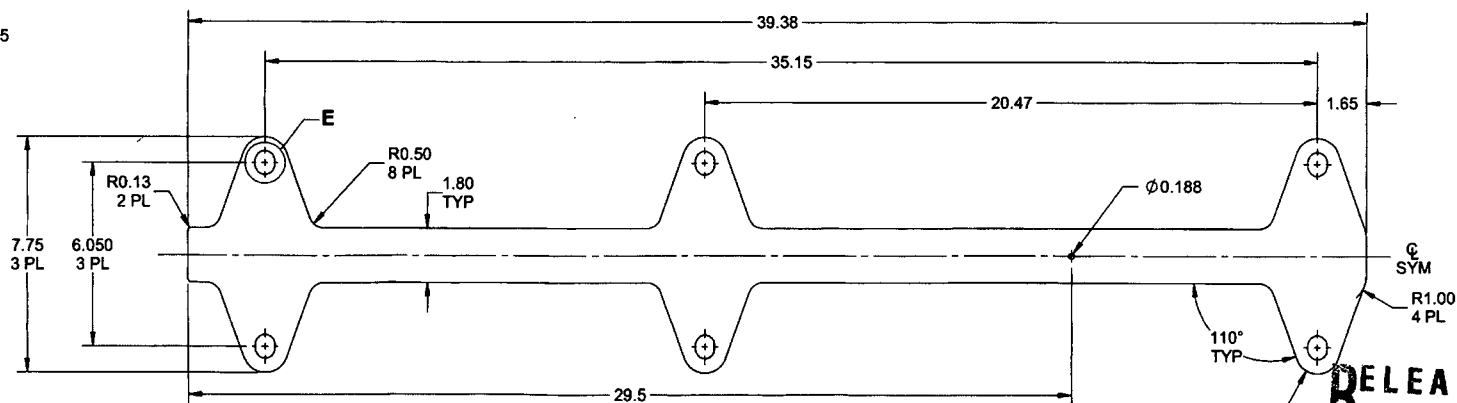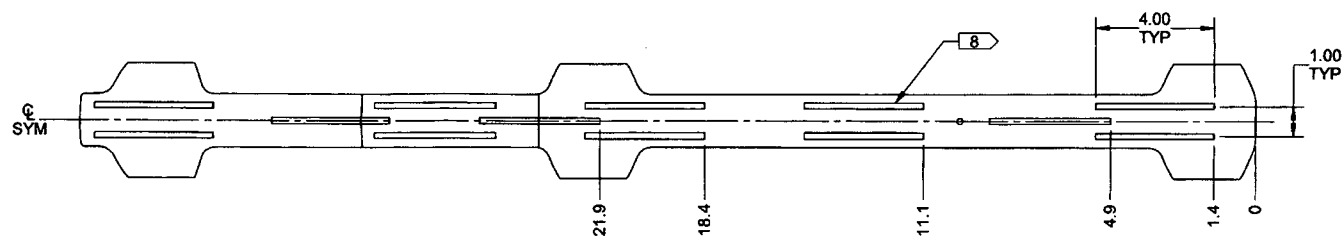

D4682-5F WEARPLATE
(FLAT PATTERN)


NOTES:



- 1) MATERIAL: AISI 304/316 STAINLESS STEEL PER MIL-S-5059 OR AMS 5513 OR AMS 5524 OR ASTM A240 OR ASME SA240 18 GAUGE 0.050 THICK, REF DART SPEC. M304S18GA
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 0.19 lbs
- 8) WELDING: PER QSI 004. APPLY LAYER OF 2059B HARDCOAT WELD TO 0.063 - 0.125 HIGH AFTER BENDING
- 9) FORM USING R1.9 DIE

APPROVED


DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	KENT, WA	
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 6 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

RELEASED
2015-06-08

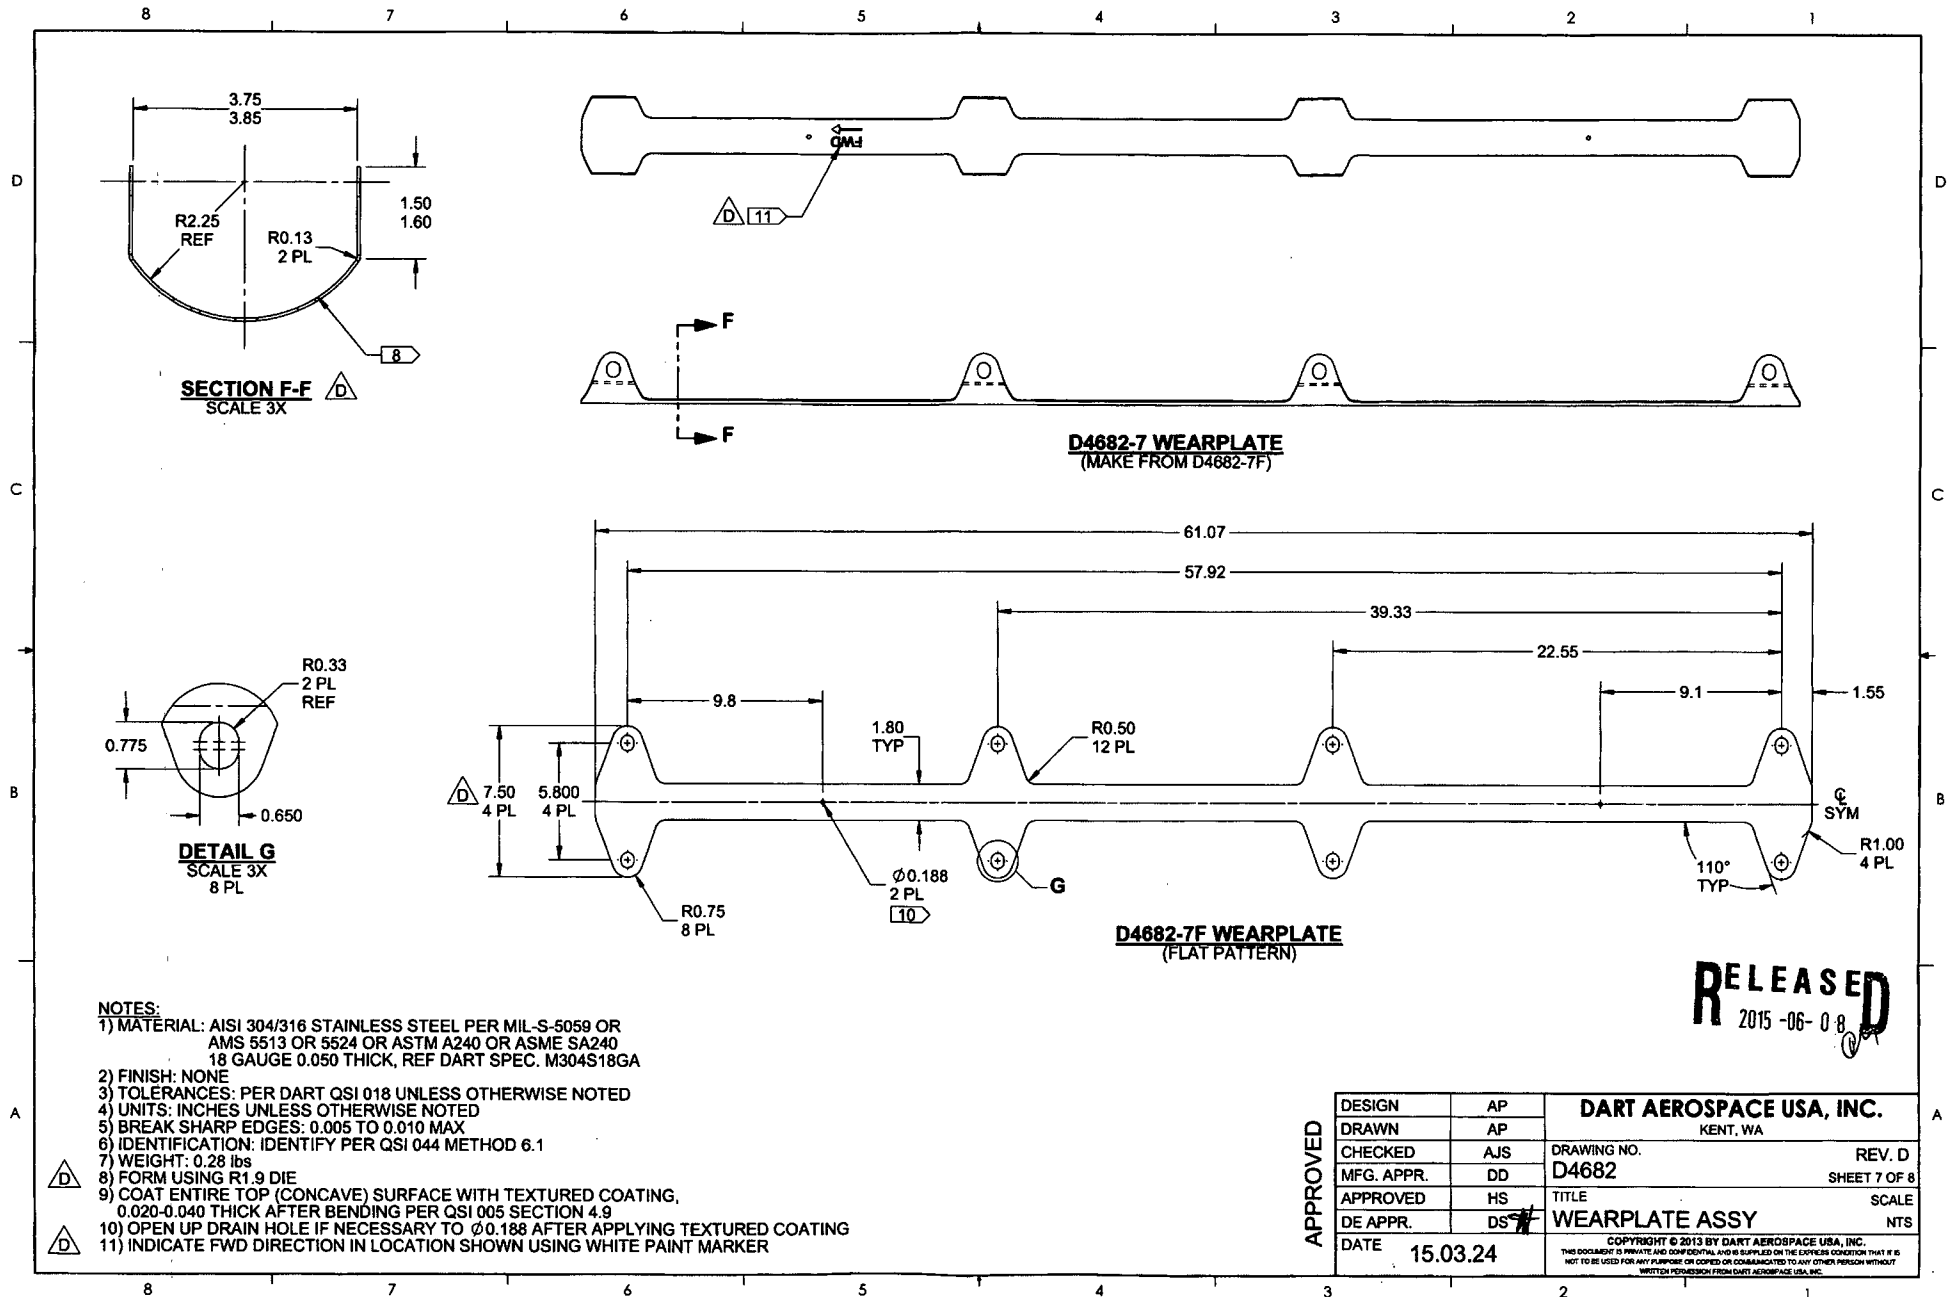

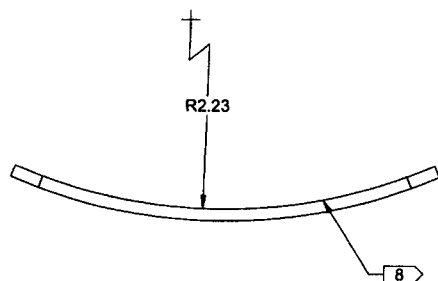

D4682-9 WEARPLATE SHIM
(MAKE FROM D4682-9F)

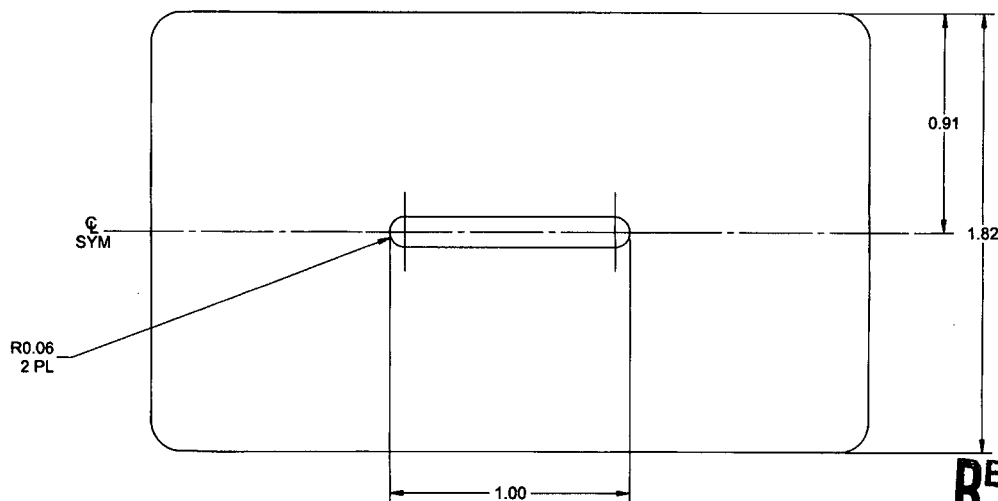

D4682-9F WEARPLATE SHIM Δ
(FLAT PATTERN)

RELEASED
2015-06-08

NOTES:

- 1) MATERIAL: AISI 304/316 STAINLESS STEEL PER MIL-S-5059 OR AMS 5513 OR AMS 5524 OR ASTM A240 OR ASME SA240 18 GAUGE 0.050 THICK, REF DART SPEC. M304S18GA
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 0.08 lbs
- 8) FORM USING R1.9 DIE

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. D
MFG. APPR.	DD	D4682	SHEET 8 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	WEARPLATE ASSY	NTS
DATE	15.03.24	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

